

# Orion Environmental Services

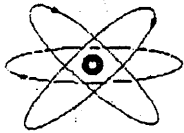
34004 9<sup>th</sup> Avenue South ♦ Building A Suite 5 ♦ Federal Way, Washington 98003-6740  
 WBE W2F5912535 Telephone Seattle (253) 874-8118 ♦ Tacoma (253) 932-6717 ♦ Facsimile (253) 927-4714 ♦ email ORION6717@aol

## Polarized Light Microscopy Test Report EPA Method 600/R-98/116

<b>Client</b>	F.S. & GS Services, Inc. 16214 - 57 <sup>th</sup> Avenue East, Suite A Puyallup, WA 98375	<b>Date</b>	July 12, 2006
		<b>Page</b>	Page 1 of 3
		<b>Invoice</b>	063129
		<b>Date Received</b>	July 12, 2006

**Project Number** 06233  
**Project Name** Elks Temple Building  
 Broadway Street  
 Tacoma, Washington

<u>Client Number</u>	<u>Orion Number</u>	<u>Stereo Scope Exam</u>	<u>Sample Treatment</u>	<u>Asbestos Percent</u>	<u>Asbestos Type</u>	<u>Other Fibers</u>
CJ-01	067012-26	Debris Pile Homogeneous	-	ND	-	Cellulose
CJ-02a	067012-27a	Skim Coat Assoc. w/ CJ-02a	-	ND	-	-
CJ-02b	067012-27b	Plaster Homogeneous	-	ND	-	Cellulose
CJ-03	067012-28	Ceiling Plaster Homogeneous	-	ND	-	Cellulose
CJ-04	067012-29	2"x2" Ceiling Tile Homogeneous	-	ND	-	Cellulose
CJ-05	067012-30	Debris Pile Homogeneous	-	ND	-	Cellulose
CJ-06	067012-31	Black Debris Homogeneous	Chloroform	ND	-	-
CJ-07a	067012-32a	Red Debris Homogeneous	Crushed	ND	-	-
CJ-07b	067012-32b	White Debris Homogeneous	Crushed	ND	-	-
CJ-08a	067012-33a	Vinyl Floor Tile Homogeneous	Ash	ND	-	-
CJ-08b	067012-33b	Dark Mastic Assoc. w/ CJ-08a	Chloroform	ND	-	Cellulose
CJ-09a	067012-34a	Green Vinyl Floor Tile Homogeneous	Ash	ND	-	-



# Orion Environmental Services

34004 9<sup>th</sup> Avenue South ♦ Building A Suite 5 ♦ Federal Way, Washington 98003-6740  
 WBE W2F5912535 Telephone Seattle (253) 874-8118 ♦ Tacoma (253) 952-6717 ♦ Facsimile (253) 927-4714 ♦ email ORION6717@aol

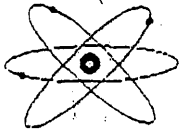
## Polarized Light Microscopy Test Report EPA Method 600/R-98/116

**Client** F.S. & GS Services, Inc.  
 16214 - 57<sup>th</sup> Avenue East; Suite A  
 Puyallup, WA 98375

**Date** July 12, 2006  
**Page** Page 2 of 3  
**Invoice** 063129  
**Date Received** July 12, 2006

**Project Number** 06233  
**Project Name** Elks Temple Building  
 Broadway Street  
 Tacoma, Washington

<u>Client Number</u>	<u>Orion Number</u>	<u>Stereo Scope Exam</u>	<u>Sample Treatment</u>	<u>Asbestos Percent</u>	<u>Asbestos Type</u>	<u>Other Fibers</u>
CJ-09b	067012-34b	Dark Mastic Assoc. w/ CJ-09a	Chloroform	ND	-	Cellulose
CJ-10a	067012-35a	Skim Coat Debris Assoc. w/ CJ-10b	-	ND	-	-
CJ-10b	067012-35b	Plaster Debris Homogeneous	-	ND	-	Cellulose
CJ-11a	067012-36a	Skim Coat Debris Assoc. w/ CJ-10b	-	ND	-	-
CJ-11b	067012-36b	Plaster Debris Homogeneous	-	ND	-	Cellulose
CJ-12a	067012-37a	Pipe Insulation Wrap Assoc. w/ CJ-12b	-	ND	-	Cellulose
CJ-12b	067012-37b	Pipe Insulation Debris Homogeneous	-	ND	-	Cellulose
CJ-13	067012-38	Pipe Insulation Debris Homogeneous	-	12	Chrysotile	Cellulose
CJ-14	067012-39	Debris Pile Homogeneous	-	ND	-	Cellulose
CJ-15a	067012-40a	Brown Vinyl Tile Homogeneous	Ash	10	Chrysotile	Cellulose



# Orion Environmental Services

34004 9<sup>th</sup> Avenue South ♦ Building A Suite 5 ♦ Federal Way, Washington 98003-6740  
WBE W2F5912535 Telephone Seattle (253) 874-8118 ♦ Tacoma (253) 952-6717 ♦ Facsimile (253) 927-4714 ♦ email ORION6717@aol


## Polarized Light Microscopy Test Report EPA Method 600/R-98/116

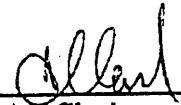
<b>Client</b>	F.S. & GS Services, Inc. 16214 - 57 <sup>th</sup> Avenue East; Suite A Puyallup, WA 98375	<b>Date</b>	July 12, 2006
		<b>Page</b>	Page 3 of 3
		<b>Invoice</b>	063129
		<b>Date Received</b>	July 12, 2006

**Project Number** 06233  
**Project Name** Elks Temple Building  
 Broadway Street  
 Tacoma, Washington

<u>Client Number</u>	<u>Orion Number</u>	<u>Stereo Scope Exam</u>	<u>Sample Treatment</u>	<u>Asbestos Percent</u>	<u>Type</u>	<u>Other Fibers</u>
CJ-15b	067012-40b	Dark Mastic Assoc. w/ CJ-15a	Chloroform	ND	-	Cellulose

Dup: Laboratory QA/QC Duplicate; M; Mastic [(a), (b), (c), etc.]: Sample layers numbered from front to back.  
 Comments: For layered samples, each component has been analyzed separately. ND means non-detect for asbestos fibers by EPA Method 600/R-98/116. Disclaimers: PLM has been known to miss asbestos in a small percentage of samples that contain asbestos. Thus negative PLM results cannot be guaranteed. Per EPA guidelines samples will be archived for 30 days then disposed of. This report may only be reproduced in full with written approval of ORION Environmental Services.

Analyzed By  Donna McNeal  
 Laboratory Director, CEO

Reviewed By  Allen Clark  
 Laboratory Analyst

*Leading Environmental Compliance Consulting Into the 21<sup>st</sup> Century*

063129

F.S. & GS. SERVICES INC.,  
16214 57<sup>th</sup> Ave. East, Suite A  
Puyallup, WA. 98375  
Phone (253) 548-1011  
Fax (253) 536-8488

**ASBESTOS**  
SAMPLE LOG AND SAMPLE NOTES

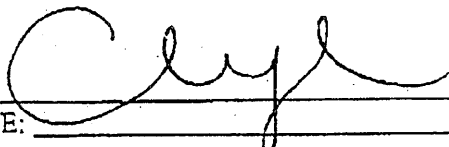
DATE: 07-12-06


PROJECT 06233

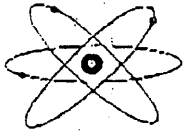
BUILDING NAME: Elks Temple Building  
ADDRESS: Broadway St  
Tacoma, WA

CLIENT: Absher Construction  
ADDRESS: P.O. Box 280  
Puyallup, WA 98371

SAMPLE #	FLOOR	AREA	TYPE OF MATERIAL
CJ01	4 <sup>TH</sup> FLOOR	OPEN AREA	DEBRI PILE
CJ02	4 <sup>TH</sup> FLOOR	ENTRY	WALL PLASTER
CJ03	4 <sup>TH</sup> FLOOR	BALCONY	CEILING PLASTER
CJ04	3 <sup>RD</sup> FLOOR	OPEN AREA	2X2 CEILING TILE
CJ05	3 <sup>RD</sup> FLOOR	OPEN AREA	DEBRI PILE
CJ06	3 <sup>RD</sup> FLOOR	OPEN AREA	DEBRI PILE
CJ07	3 <sup>RD</sup> FLOOR	OPEN AREA	DEBRI PILE
CJ08	3 <sup>RD</sup> FLOOR	KITCHEN	FLOOR TILE AND MASTIC
CJ09	3 <sup>RD</sup> FLOOR	OFFICE	GREEN VAT AND MASTIC
CJ10	2 <sup>ND</sup> FLOOR	MEZZANINE	CEILING DEBRI
CJ11	2 <sup>ND</sup> FLOOR	SPANISH STEPS	CEILING DEBRI
CJ12	2 <sup>ND</sup> FLOOR	SPANISH STEPS	PIPE INSULATION DEBRI
CJ13	1 <sup>ST</sup> FLOOR	OFFICE	PIPE INSULATION DEBRI
CJ14	1 <sup>ST</sup> FLOOR	POOL/BOILER ROOM	DEBRI PILE
CJ15	1 <sup>ST</sup> FLOOR	ENTRY	BROWN VAT AND MASTIC

Inspector:   
DATE/TIME: \_\_\_\_\_

RECEIVED BY: 



# Orion Environmental Services

34004 9<sup>th</sup> Avenue South ♦ Building A Suite 5 ♦ Federal Way, Washington 98003-6740  
 WBF W2F5912535 Telephone Seattle (253) 874-8118 ♦ Tacoma (253) 952-6717 ♦ Facsimile (253) 927-4714 ♦ email ORION6717@aol

## Polarized Light Microscopy Test Report EPA Method 600/R-98/116

<b>Client</b>	F.S. & GS Services, Inc. 16214 - 57 <sup>th</sup> Avenue East, Suite A Puyallup, WA 98375	<b>Date</b>	July 14, 2006
		<b>Page</b>	Page 1 of 1
		<b>Invoice</b>	063189
		<b>Date Received</b>	July 14, 2006

**Project Number** 06233  
**Project Name** Absher Construction  
 Elks Temple

<u>Client Number</u>	<u>Orion Number</u>	<u>Stereo Scope Exam</u>	<u>Sample Treatment</u>	<u>Asbestos Percent</u>	<u>Asbestos Type</u>	<u>Other Fibers</u>
CJ-01a	60714-49a	Roof Covering Assoc. CJ-01b	-	ND	-	-
CJ-01b	60714-49b	Insulation Material Homogenous	-	ND	-	Cellulose Fiberglass
CJ-01c	60714-49c	Built-Up Roofing Homogeneous	Ash	<1	Chrysotile	Cellulose
CJ-01d	60714-49d	Built-Up Roofing Homogeneous	Ash	ND	-	Cellulose
CJ-01e	60714-49e	Built-Up Roofing Homogeneous	Ash	ND	-	Cellulose

Dup: Laboratory QA/QC Duplicate; M; Mastic [(a), (b), (c), etc.]: Sample layers numbered from front to back.  
 Comments: For layered samples, each component has been analyzed separately. ND means non-detect for asbestos fibers by EPA Method 600/R-98/116. Disclaimers: PLM has been known to miss asbestos in a small percentage of samples that contain asbestos. Thus negative PLM results cannot be guaranteed. Per EPA guidelines samples will be archived for 30 days then disposed of. This report may only be reproduced in full with written approval of ORION Environmental Services.

Analyzed By Donna McNeal  
 Donna McNeal  
 Laboratory Director, CEO

Reviewed By Allen Clark  
 Allen Clark  
 Laboratory Analyst

*Leading Environmental Compliance Consulting Into the 21<sup>st</sup> Century*